

取扱説明書

このたびは、本製品をお買い上げいただきまして、まことにありがとうございます。 ご使用に際しては、次の内容をお守りください。

以所に成べいるいかい方面をおり、ハレビン。 ・電気の知識を有する専門象がお取り扱いください。 ・この取扱説明書をよくお読みになり、十分にご理解のうえ、正しくご使用ください。 ・この取扱説明書はいつでも参照できるよう大切に保管してください。

TRACEABILITY INFORMATION: Representative in EU: Omron Europe B.V. Wegalaan 67-69 2132 JD Hoofddorp,


Manufacturer: Omron Corporation GIIIFOR CORPORATION,
Sensing Devices Division H.Q.
Industrial Sensors Division
& Application Sensors Division
Shiokoji Horikawa, Shimogyo-ku,
Kyoto, 600-8530 JAPAN



オムロン株式会社

© OMRON Corporation 2000 All Rights Reserved

■外形寸法図

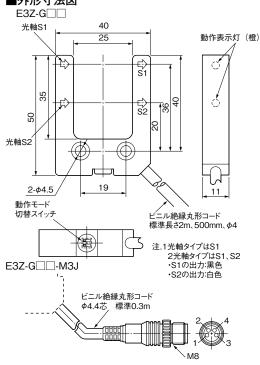

OMRON Meaning of warning symbol This symbol indicates a potentially hazardous

Warning symbol

Risk of explosion.

igni-tion gas.

Detecting distance

Current consumption

Ambient temperature

Ambient humidity

Protection structure

Supply voltage

Control output

Response time

Materials

Output

Type Output crcuit

Model E3Z-G PHOTOELECTRIC SENSOR

INSTRUCTION SHEET

Thank you for selecting OMRON product. This sheet primarily describes precautions required in installing and operating the product.

Before operating the product, read the sheet thoroughly to acquire sufficient knowledge of the product. For your convenience, keep the sheet at your disposal.


TRACEABILITY INFORMATION: Representative in EU: Omron Europe B.V. Wegalaan 67-69

Manufacturer:
Omron Corporation,
Sensing Devices Division H.Q.
Industrial Sensors Division
& Application Sensors Division
Shiokoii Horikawa. Shimogove-ku. Shiokoji Horikawa, Shimogyo-ku, Kyoto, 600-8530 JAPAN

The following notice applies only to products that carry the CE mark:

Notice:
This is a class A product. In residential areas it may cause radio interference, in which case the user may be required to take adequimeasures to reduce interference.

© OMRON Corporation 2000 All Rights Reserved.

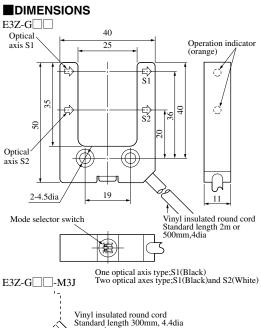

安全上のご注意

●警告表示の意味

誤った取り扱いをすると、傷害を負う可能性が想定される 場合。および物的損害が発生が想定される場合を示しま

●警告表示

注意

AC電源では絶対に使用しないで下さい。 破裂の恐れがあります。



安全上の要点

以下に示すような項目は、安全を確保する上で必要なことですので必ず守

(1)引火性、爆発性ガスの環境では使用しないでください。

(2)この製品は、分解したり、修理、改造をしないでください。 (3)電源電圧は、仕様電圧(DC12~24V±10%) でご使用ください。 (4)負荷は、定格以下でご使用ください。

■定格性能

光軸数		1光軸	2光軸
形式	NPN出力	E3Z-G61 / -G61-M3J	E3Z-G62/-G62-M3J
	PNP出力	E3Z-G81 / -G81-M3J	E3Z-G82/-G82-M3J
検出距離		25mm	
光源(発光波長)		赤外発光ダイオード(940nm)	
電源電圧		DC12~24V±10% リップル(p-p)10%以下	
消費電流		25mA	40mA
制御出力		負荷電源電圧DC26.4V以下、負荷電流100mA以下(残留電圧1V以下) オープンコレクタ出力(NPN/PNP出力 形式によって異なります。) 入光時ON/レゃ光時ON 動作モード切換スイッチにて切換*	
応答時間		動作·復帰·各1ms以下	
周囲温度		動作時:−25~+55℃、保存時:−40~+70℃(ただし、氷結、結露しないこと)	
周囲湿度		動作時:35~85%RH、保存時:35~95%RH(ただし、氷結、結露しないこと)	
保護構造		IEC60529規格 IP64	
材 質		ケース:ABS、パッキン:NBR	

*入光ON/しゃ光時ON 切換 動作モード切換スイッチを 以下のように設定してください。

使用上の注意

①最大電源電圧はDC26.4Vです。通電前に電源電圧が最大電源電圧

②電力線、動力線と光電スイッチの配線が同一配管または同一ダクトで行

ので、別配線またはシールドコードの使用を原則としてください。

⑥ネジはM4を使用し、締めトルクは0.78N・m以下にしてください。

⑦コネクタの抜差は必ず電源を切ってから行なってください。

⑧コネクタの抜差は必ずコネクタカバー部を持って行なってください。

コードの延長は0.3mm²以上の線を用い、100m以下としてください。

⑤光電スイッチを取り付ける際、ハンマーなどでたたきますと、耐水 機能が損なわれますのでご注意ください。

われると誘導を受け、誤動作あるいは破損の原因となる場合もあります

(1)下記の設置場所では使用しないでください。

②湿度が高く、結露する恐れがある場所

④本体に直接、振動や衝撃が伝わる場所


以下であることを確認してください。

④コード部は強く引っ張らないようにしてください。

①直射日光があたる場所

③腐食性ガスのある場所

(2)接続、取り付けについて

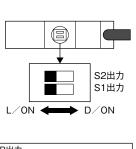

■出力段回路図 出力形態 NPN出力 PNP出力 形式 形E 3 Z-G61/-G61-M3J 形E 3 Z-G81/-G81-M3J 出力回路 動作 表示灯 S1 動作 表示灯 S1 DC12~24V DC12~24V 負荷 (橙) コネクタ ピン配置※ (橙) コネクタ ピン配置※ 黒 制御出力S1 光電 黒[‡]制御出力S1 **②④** スイッチ 主回路 24 100mA以下 100mA以下 負荷 ※②は空き端子 ※②は空き端子 形式 形E 3 Z-G62/-G62-M3J 形E 3 Z-G82/-G82-M3J 出力回路 動作 表示灯 動作 表示灯 82 (橙) (橙) DC12~24V DC12~24V 負荷 制御出力S1 100mA以了 本 コネクタ ピン配置 光電 光電 黒 制御出力S2 24 **②**④ 100mA以下 100mA以下 (3) 3 白 制御出力S2 100mA以下 負荷 負荷

0٧

Precautions on Safety

Precautions for Safe Use

(1)Do not use the sensor under the environment with explosive or

(3)Keep the supply voltage within the specified range. (12to24V DC±10%)

1axis

E3Z-G61/-G61-M3J

E3Z-G81/-G81-M3J

25mA max

Be sure to follow the safety precautions below for added safety.

(2) Never disassemble, repair nor tamper with the product.

or serious injury.

Do not connect sensor to AC power supply.

(4)Do not use the sensor over the rated values.

Optical axis

NPN output

PNP output

■OUTPUT STAGE CIRCUIT DIAGRAM

Operation indicator S1

 \triangle

NPN output

E3Z-G61/-G61-M3J

Brown

white

(control output S2) 100mA max

Load

RATED PERFORMANCE

Light source (luminescence wavelength)

situation which, if not avoid, could result in death

Precautions for Correct Use

(1)Do not use the product under the following conditions

In the place exposed to the direct sunlight.

In the place where humidity is high and condensation may occur.

③In the place where corrosive gas exists. ④In the place where vibration or shock is directly transmitted to

the product.
(2)Connection and Mounting

①Be sure that before making supply the supply voltage is less than the maximum rated supply voltage. (26.4V DC)

(2) There are some cases where the photoelectric switch cable isunavoidably laid in a tube or duct together with a hightension

or power line. This causes an induction, possibly resulting in malfunction or damage. In principal, the cable should be separately laid or

3For extending wires, use a cable 0.3mm² min. and 100m max. in

length.

4Do not pull the wire strongly.

40mA max

Infrared LED (940nm)

12 to 24V DC±10% (Ripple (p-p) 10% max.)

Load supply voltage: 26.4V DC max. Load current: 100mA max.

Light-ON/Dark-ON switch selectable*

1ms max.

IEC60529: IP64

Case: ABS, Cap: NBR

(Residual voltage : 1V max.)

Open collector output(NPN/PNP output,changin

12to 24V DC

Connector*


⑤Excessive force (hitting by hammer, etc.) should not be put on the photoelectric switch because it may damage its

water-resistance characteristic. @Use M4 screws to mount the photoelectric switch. Do not exceed 0.78N m torque when tightening screws.

©M8metal connector


Plug in or out the connector after surly turning off a power supply.

2axes *Light-ON/Dark-ON E3Z-G62/-G62-M3J switch selectable Set the mode selector E3Z-G82/-G82-M3J

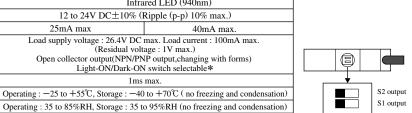


Light-ON Dark-ON

switch as following:

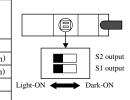


24

3

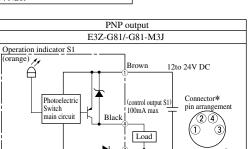

Load

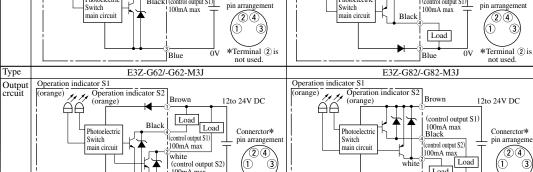

24

(1)

0V

この機種は、負荷短絡保護機能を備えています。負荷短絡が生じた場 合は出力がOFFとなりますので配線を見直したうえで電源を再投入して ください。短絡保護回路がリセットされます。また負荷短絡保護は定格負 荷電流の1.8倍以上の電流が流れますと動作します。L負荷を使用され る場合は突入電流が定格負荷電流の1.8倍以下のものをご使用くださ

⑨固定具は必ず手で締めてください。プライヤなどを使用されますと

⑩適正締め付けトルクは0.3~0.4N·mです。締め付けが不十分ですと保

市販のスイッチングレギュレータをご使用の際はFG(フレーム・グランド

電源を入れてから光電スイッチが検出可能になる時間は100msですの

で、電源投入後100ms以降にてご使用ください。負荷と光電スイッチが

別電源に接続されている場合は必ず光電スイッチの電源を先に投入し

電源OFF時に出力パルスが発生する場合がありますので負荷あるいは

護構造が保てなくなったり、振動でゆるむことがあります。

シンナー類は、製品表面を溶かしますので避けてください。

負荷ラインの電源を先にOFFされることをお勧めします。

(8)耐水性について

破損の原因になります。

(5)電源リセット時間について

(6)電源のOFFについて

(7)負荷短絡保護について

端子)を接地してお使いください。

(3)清掃について

(4)電源について

耐水性を確保するために、動作モード切換スイッチ部のキャップを取付け




①安全を確保する目的で直接的または間接的に人体を検出する用途に、本製品を使用し △エニッキル・アシロロリン世接的または同接的に人体を検出する用途に、本製品を使用ないでください。同用途には、当社センサカタログに掲載している安全センサをご使用がさい。

ださい。
②下記用途に使用される場合、当社営業担当者までご相談のうえ仕様書などによりご確認いただくともに、定格・性能に対し余裕を持った使い方や、万一故障があっても危険を最小にする安全回路などの安全対策を講じてください。
3)屋外の用途、潜在的な化学的万染あるいは電気的妨害を被る用途またはカタログ、取扱説明書等に記載のない条件や環境での使用b)原子力制御設備、焼却設備、焼造・航空・再向設備、医用機械、娯楽機械、安全装置、および行政側での場所に行う記備

c)人命や財産に危険が及びうるシステム・機械、装置
いれて、水学、電学の代格が、フェールなりまり事業に乗れた、フェールなどの

d)ガス、水道、電気の供給システムや24時間連続運転システムなどの U) / ハ、ハ・Jは、电 XI (の) ドロシステンペン44 (中) 注喩が重報システンなとい 高い (信頼性が必要な設施 e) その他、上記 e) ~ d) に準する、高度な安全性が必要とされる用途 *上記は適合用途の条件の一部です。当社のベスト総合カタログ・データシート等最新版 のカタログ、マニュアルに記載の保証・免責事項の内容をよく読んでご使用ください。

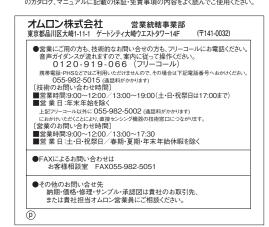

8Plug in or out the connector with a cover part of it. 9Fasten a fixed implement by hand. If you use a plaier, it may be

cause of malfunction or damage to it. Proper bolting torque is 0.3 to 0.4N · m to keep water-resistance.

(3)Cleaning

Do not use thinner such as alcohol and benzine because it may melt a surface of a product.

(4)Power supply

When using a commercially available switching regulator, be sure to ground the FG (Frame Ground) terminals.

(5)Power supply reset time The photoelectric switch will begin sensing no later than 100ms after the power is turned on. If the load and the photoelectric

switch is connected to different power supply, the photoelectric switch must be always turned on first. (6)Turning off the power supply

When turning off the power, output pulse may be generated. We recommend turning off the power supply of the load or load line

(7)Load short circuit protection This product is provided with function of load short circuit protection.

Control output is turned off when this function operates.

After checking of wiring and load current, make power supply again. Then the circuit is reset.

Load short circuit protection operates when the current is 1.8 times over than the rated load current. The inrush current should be 1.8 times less than the rated load

current when L load is used. (8)To ensure the water proof of the sensor, put the cap on the

mode selector switch.

Recommended Forbidden æ

Suitability for Use

THE PRODUCTS CONTAINED IN THIS SHEET ARE NOT SAFETY RATED. THEY ARE NOT DESIGNED OR RATED FOR ENSURING SAFETY OF PERSONS, AND SHOULD NOT BE RELIED UPON AS A SAFETY COMPONENT OR PROTECTIVE DEVICE FOR SUCH PURPOSES.

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of the products in the customer's application or use of the product.

Take all necessary steps to determine the suitability of the product for the systems, machines, and equipment with which it will be used. Know and observe all prohibitions of use applicable to this product.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE BISKS

AND THAT THE OMBON PRODUCT IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM. See also Product catalog for Warranty and Limitation of Liability.

EUROPE OMRON EUROPE B.V. Sensor Business Unit

Carl-Benz Str.4, D-71154 Nufringen Germany Phone:49-7032-811-0 Fax: 49-7032-811-199 NORTH AMERICA

OMRON ELECTRONICS LLC

One Commerce Drive Schaumburg,IL 60173-5302 U.S.A Phone:1-847-843-7900 Telephone Consultation 1-800-55-OMRON Fax: 1-847-843-7787 ASIA-PACIFIC

OMRON ASIA PACIFIC PTE LTD 83 Clemenceau Avenue,#11-01 UE Square,Singapore 239920 Phone : 65-6-835-3011 /Fax :65-6-835-2711

(n)

OMRON Corporation